TOYOTA Tundra/HV/Sequoia HV 2022 - CONSOLE SAFE

Part Number: PT971-34232

Kit Contents

Item #	Quantity Reqd.	Description
1	1	Console Safe
2		
3		

Vehicle Service Parts (may be required for reassembly)

Item #	Quantity Reqd.	Description
1		
2		
3		

Hardware Bag Contents

Item #	Quantity Reqd.	Description
1	1	Aluminum Spacer-0.84”ODx0.622”IDx0.357”L
	1	Aluminum Spacer-0.84”ODx0.622”IDx0.582”L
3	1	M6x30mm Hex Drive Cap Screw
4	1	M6x35mm Hex Drive Cap Screw
5	2	¼” Flat Washer

Legend

- **STOP:** Damage to the vehicle may occur. Do not proceed until process has been complied with.
- **OPERATOR SAFETY:** Use caution to avoid risk of injury.
- **CAUTION:** A process that must be carefully observed in order to reduce the risk of damage to the accessory/vehicle and to ensure a quality installation.
- **TOOLS & EQUIPMENT:** Used in Figures calls out the specific tools and equipment recommended for this process.
- **REVISION MARK:** This mark highlights a change in installation with respect to previous issue.
- **SAFETY TORQUE:** This mark indicates that torque is related to safety.
- **REGULATORY MARK:** This mark indicates the component is related to regulatory compliance

Additional Items Required For Installation

Item #	Quantity Reqd.	Description
1		

Conflicts

Recommended Tools

Personal & Vehicle Protection	**Notes**
Special Tools	**Notes**
Installation Tools	**Notes**
Wrench w/ extension	For disassembly and installation
10mm socket	For disassembly
4mm Hex Key	For installation
Torque Wench	For installation
Special Chemicals	**Notes**

General Applicability

MY22+ Tundra/HV; MY23+ Sequoia HV

Recommended Sequence of Application

Item #	Accessory
1	
2	
3	

*Mandatory

Issue: A 05/28/2025

TOYOTA Tundra/HV/Sequoia HV 2022 - CONSOLE SAFE

Procedure

Care must be taken when installing this accessory to ensure damage does not occur to the vehicle. The installation of this accessory should follow approved guidelines to ensure a quality installation.

These guidelines can be found in the "Accessory Installation Practices" document.

This document covers such items as:

- Vehicle Protection (use of covers and blankets, cleaning chemicals, etc.).
- Safety (eye protection, rechecking torque procedure, etc.).
- Vehicle Disassembly/Reassembly (panel removal, part storage, etc.).
- Electrical Component Disassembly/Reassembly (battery disconnection, connector removal, etc.).

Please see your Toyota dealer for a copy of this document.

1. Prepare Vehicle for Safe Installation.

(a) Verify the kit contents.

(b) Remove the contents of Center Console, including the bottom mat

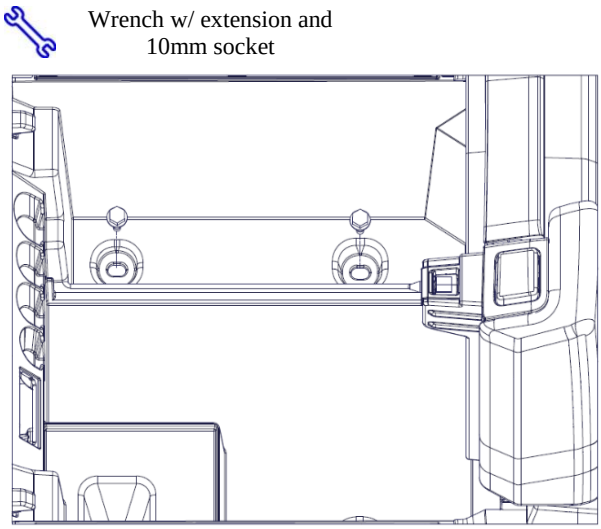


Fig. 1-1

2. Remove Factory Mounting Hardware.

(a) Remove the 2 factory mounting screws from the bottom of the Center Console. They will not be reused (Fig. 1-1).

Issue: A 05/28/2025

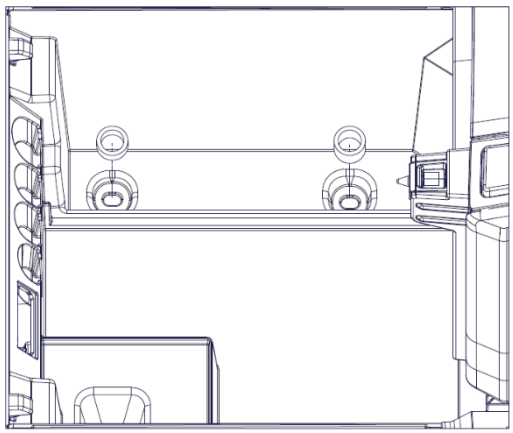


Fig. 1-2

3. Place Aluminum Spacers.

(a) Insert the 2 Aluminum Spacers into the recesses in the bottom of the Center Console (Fig. 1-2). Longer Spacer (Item #2) should be placed in the rearward most recesses. The Shorter spacer (Item #1) will be placed in the forward most recesses.

4. Insert Console Safe into Empty Console and assemble Cap screws.

(a) Open Console Safe lid. The open lid will be oriented toward the Passenger Side of the Vehicle (Fig. 1-3).

(b) Assemble shorter cap screw (Item #3) to the frontward opening.

(c) Assemble longer cap screw (Item #4) to the rearward opening.

(d) Tighten the Screws to 6.7 N-m (Fig. 1-3).

Torque wrench w/ extension and hex key

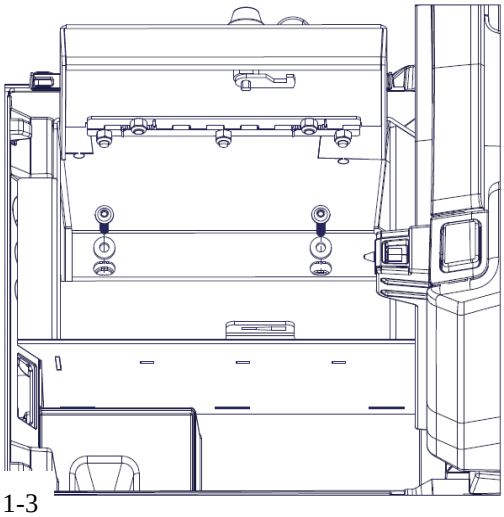


Fig. 1-3

Issue: A 05/28/2025

TOYOTA Tundra/HV/Sequoia HV 2022 - CONSOLE SAFE

Checklist - these points **MUST** be checked to ensure a quality installation.

Check:	Look For:
Accessory Function Checks	
☐ Verify parts:	Removed items have been discarded & replaced items are in place
☐	
☐	
☐	
Vehicle Function Checks	
☐	
☐	
☐	
Vehicle Appearance Check	
☐ After accessory installation and removal of protective cover(s), perform a visual inspection.	Ensure no damage (including scuffs and scratches) was caused during the installation process. (For PPO installations, refer to TMS Accessory Quality Shipping Standard.)

Issue: A 05/28/2025